


CRANE SCALES – OCS-S

- * Model: OCS-S
- * Capacity: 3t--20t
- * Standard: OIML III
- * CE approved
- * Units: Kg/lb/N
- * A luminum die-casting enclosure
- * 38mm LED display
- * Infrared remote controller
- * High duty bow shackle and hook
- * Stainless steel button
- * Low battery warning
- * Battery: 6V/10Ah; Adapter, 9V/1500mA



Accuracy class	OIML III
Tare range	100%F.S.
Zero range	4%F.S.
Safe overload	125%F.S.
Ultimate overload	400%F.S.
Overload alarm	100%F.S.+9e
Battery	6V/10Ah
Adaptor	DC9V
Battery life	≥ 50 hours
Operating temperature	-20°C ~ +50°C
Operating humidity	≤85% rH under 20°C
Remote controller dist.	Max. 15m

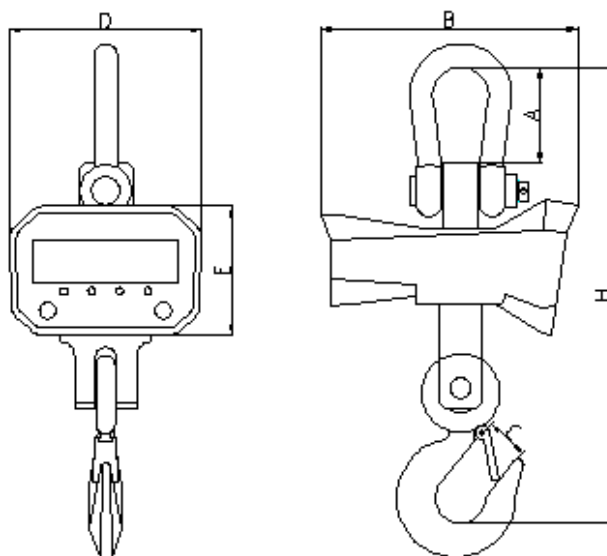

MODEL	Cap.(kg)	Resolution(kg)	A(mm)	B(mm)	C(mm)	D(mm)	E(mm)	H(mm)	G.W.(kg)
OCS-3S	3000	1	95	260	45	195	130	460	13
OCS-5S	5000	2	125	325	55	235	158	525	19
OCS-10S	10000	5	140	325	65	235	158	660	29
OCS-15S	15000	5	175	345	70	235	160	805	57
OCS-20S	20000	10	175	345	85	235	160	870	63

Features :

◆ Enclosure:

NEMA 12/IP54 powder coated Foundry Cast Aluminum

◆ Multi-weighing units:

Kg, lb are selectable, kg are default unit.

◆ Multi-function operation:

Tare, Zero, Auto zero tracking, Total, Hold, Overload warning and record, operated through infrared remote controller.

◆ User-friendly design:

Large red 5 digit LED display (digit height 30mm), Battery Operated with low battery indication, Automatic turn off, power-saving function.

Special design loadcell, threadless connection, more safety.

◆ Gravity regulation:

The acceleration of gravity can be regulated through remote controller according to different places value.

◆ Multi options:

RS-232-continuous or on demand data output, user-selectable.

Wireless big screen 3", 5", wireless indicator 180, 280, 380, 580 can match with the scale, user-selectable.